

HOME REPORT



**Hardies**

PROPERTY & CONSTRUCTION CONSULTANTS





# Energy Performance Certificate



# Energy Performance Certificate (EPC)

89 BENVIEW, BANNOCKBURN, STIRLING, FK7 0HJ

**Dwelling type:** Detached house  
**Date of assessment:** 17 June 2015  
**Date of certificate:** 17 June 2015  
**Total floor area:** 143 m<sup>2</sup>


**Reference number:** 9139-1012-0206-0275-6900  
**Type of assessment:** RdSAP, existing dwelling  
**Primary Energy Indicator:** 180 kWh/m<sup>2</sup>/year  
**Main heating and fuel:** Boiler and radiators, mains gas

## You can use this document to:

- Compare current ratings of properties to see which are more energy efficient and environmentally friendly
- Find out how to save energy and money and also reduce CO<sub>2</sub> emissions by improving your home

<b>Estimated energy costs for your home for 3 years*</b>	<b>£3,120</b>	See your recommendations report for more information
<b>Over 3 years you could save*</b>	<b>£615</b>	

\* based upon the cost of energy for heating, hot water, lighting and ventilation, calculated using standard assumptions

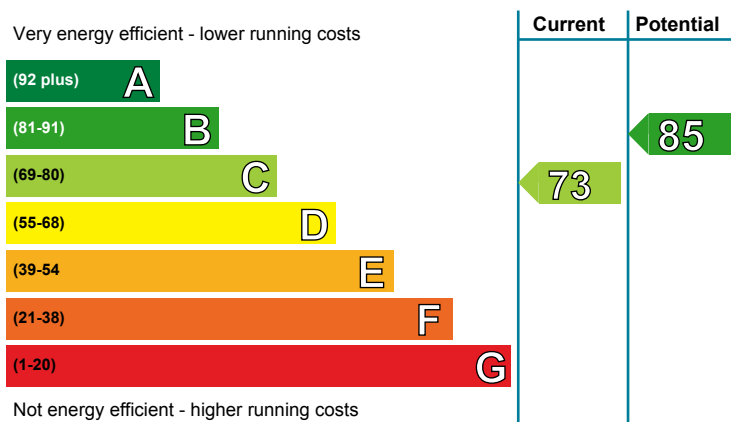


## Energy Efficiency Rating

This graph shows the current efficiency of your home, taking into account both energy efficiency and fuel costs. The higher this rating, the lower your fuel bills are likely to be.

Based on calculated energy use of **180 kWh/m<sup>2</sup>/yr**, your current rating is **band C (73)**. The average rating for a home in Scotland is **band D (61)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

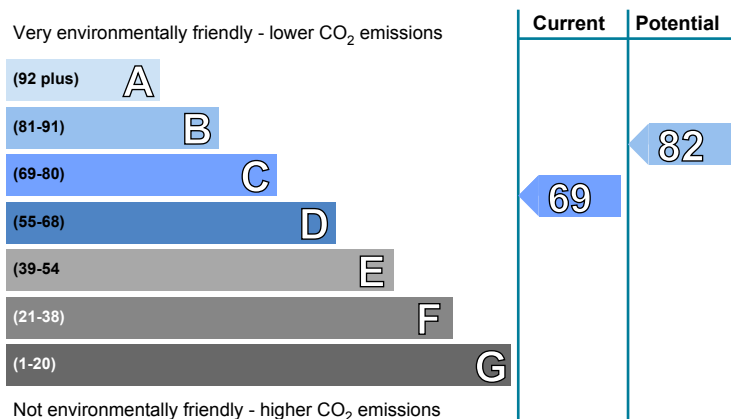

## Environmental Impact (CO<sub>2</sub>) Rating

This graph shows the effect of your home on the environment in terms of carbon dioxide (CO<sub>2</sub>) emissions. The higher the rating, the less impact it has on the environment.

Based on calculated emissions of **4 kg CO<sub>2</sub>/m<sup>2</sup>/yr**, your current rating is **band C (69)**. The average rating for a home in Scotland is **band D (59)**.

The potential rating shows the effect of undertaking all of the improvement measures listed within your recommendations report.

## Top actions you can take to save money and make your home more efficient

Recommended measures	Indicative cost	Typical savings over 3 years	Available with Green Deal
1 Low energy lighting	£120	£192.00	
2 Condensing boiler	£2,200 - £3,000	£276.00	✓
3 Solar water heating	£4,000 - £6,000	£147.00	✓

A full list of recommended improvement measures for your home, together with more information on potential cost and savings and advice to help you carry out improvements can be found in your recommendations report.



The Green Deal may allow you to make your home warmer and cheaper to run at no up-front capital cost. See your recommendations report for more details.

**THIS PAGE IS THE ENERGY PERFORMANCE CERTIFICATE WHICH MUST BE AFFIXED TO THE DWELLING AND NOT BE REMOVED UNLESS IT IS REPLACED WITH AN UPDATED CERTIFICATE**

## Summary of the energy performance related features of this home

This table sets out the results of the survey which lists the current energy-related features of this home. Each element is assessed by the national calculation methodology; 1 star = very poor (least efficient), 2 stars = poor, 3 stars = average, 4 stars = good and 5 stars = very good (most efficient). The assessment does not take into consideration the condition of an element and how well it is working. 'Assumed' means that the insulation could not be inspected and an assumption has been made in the methodology, based on age and type of construction.

Element	Description	Energy Efficiency	Environmental
Walls	Timber frame, as built, insulated (assumed)	★★★★★	★★★★★
Roof	Pitched, 200 mm loft insulation	★★★★☆	★★★★☆
Floor	Suspended, insulated (assumed)	—	—
Windows	Fully double glazed	★★★★☆	★★★★☆
Main heating	Boiler and radiators, mains gas	★★★★☆	★★★★☆
Main heating controls	Programmer, room thermostat and TRVs	★★★★☆	★★★★☆
Secondary heating	None	—	—
Hot water	From main system	★★★★☆	★★★★☆
Lighting	No low energy lighting	★☆☆☆☆	★☆☆☆☆

## The energy efficiency rating of your home

Your Energy Efficiency Rating is calculated using the standard UK methodology, RdSAP. This calculates energy used for heating, hot water, lighting and ventilation and then applies fuel costs to that energy use to give an overall rating for your home. The rating is given on a scale of 1 to 100. Other than the cost of fuel for electrical appliances and for cooking, a building with a rating of 100 would cost almost nothing to run.


As we all use our homes in different ways, the energy rating is calculated using standard occupancy assumptions which may be different from the way you use it. The rating also uses national weather information to allow comparison between buildings in different parts of Scotland. However, to make information more relevant to your home, local weather data is used to calculate your energy use, CO<sub>2</sub> emissions, running costs and the savings possible from making improvements.

## The impact of your home on the environment

One of the biggest contributors to global warming is carbon dioxide. The energy we use for heating, lighting and power in our homes produces over a quarter of the UK's carbon dioxide emissions. Different fuels produce different amounts of carbon dioxide for every kilowatt hour (kWh) of energy used. The Environmental Impact Rating of your home is calculated by applying these 'carbon factors' for the fuels you use to your overall energy use.

The average Scottish household produces about 6 tonnes of carbon dioxide every year. Based on this assessment, heating and lighting this home currently produces approximately 4.5 tonnes of carbon dioxide every year. Adopting recommendations in this report can reduce emissions and protect the environment. If you were to install all of these recommendations this could reduce emissions by 1.8 tonnes per year. You could reduce emissions even more by switching to renewable energy sources.

## Estimated energy costs for this home



	Current energy costs	Potential energy costs	Potential future savings
Heating	£2,190 over 3 years	£2,028 over 3 years	
Hot water	£462 over 3 years	£243 over 3 years	
Lighting	£468 over 3 years	£234 over 3 years	
<b>Totals</b>	<b>£3,120</b>	<b>£2,505</b>	

These figures show how much the average household would spend in this property for heating, lighting and hot water. This excludes energy use for running appliances such as TVs, computers and cookers, and the benefits of any electricity generated by this home (for example, from photovoltaic panels). The potential savings in energy costs show the effect of undertaking all of the recommended measures listed below.

## Recommendations for improvement

The measures below will improve the energy and environmental performance of this dwelling. The performance ratings after improvements listed below are cumulative; that is, they assume the improvements have been installed in the order that they appear in the table. Further information about the recommended measures and other simple actions to take today to save money is available from the Home Energy Scotland hotline which can be contacted on 0808 808 2282. Before carrying out work, make sure that the appropriate permissions are obtained, where necessary. This may include permission from a landlord (if you are a tenant) or the need to get a Building Warrant for certain types of work.

Recommended measures	Indicative cost	Typical saving per year	Rating after improvement		Green Deal
			Energy	Environment	
1 Low energy lighting for all fixed outlets	£120	£64	C 74	C 70	
2 Replace boiler with new condensing boiler	£2,200 - £3,000	£92	C 77	C 74	✓
3 Solar water heating	£4,000 - £6,000	£49	C 78	C 76	✓
4 Solar photovoltaic panels, 2.5 kWp	£5,000 - £8,000	£236	B 85	B 82	✓

Measures which have a green deal tick  are likely to be eligible for Green Deal finance plans based on indicative costs. Subsidy also may be available for some measures, such as solid wall insulation. Additional support may also be available for certain households in receipt of means tested benefits. Measures which have an orange tick  may need additional finance. To find out how you could use Green Deal finance to improve your property, visit [www.greenerscotland.org](http://www.greenerscotland.org) or contact the Home Energy Scotland hotline on 0808 808 2282.

### Alternative measures

There are alternative improvement measures which you could also consider for your home. It would be advisable to seek further advice and illustration of the benefits and costs of such measures.

- Biomass boiler (Exempted Appliance if in Smoke Control Area)
- Air or ground source heat pump
- Micro CHP

## Choosing the right improvement package

For free and impartial advice on choosing suitable measures for your property, contact the Home Energy Scotland hotline on 0808 808 2282 or go to [www.greenerscotland.org](http://www.greenerscotland.org).

## About the recommended measures to improve your home's performance rating

This section offers additional information and advice on the recommended improvement measures for your home

### 1 Low energy lighting

Replacement of traditional light bulbs with energy saving recommended ones will reduce lighting costs over the lifetime of the bulb, and they last up to 12 times longer than ordinary light bulbs. Also consider selecting low energy light fittings when redecorating; contact the Lighting Association for your nearest stockist of Domestic Energy Efficient Lighting Scheme fittings.

### 2 Condensing boiler

A condensing boiler is capable of much higher efficiencies than other types of boiler, meaning it will burn less fuel to heat this property. This improvement is most appropriate when the existing central heating boiler needs repair or replacement, however there may be exceptional circumstances making this impractical. Condensing boilers need a drain for the condensate which limits their location; remember this when considering remodelling the room containing the existing boiler even if the latter is to be retained for the time being (for example a kitchen makeover). Building regulations generally apply to this work and a building warrant may be required, so it is best to obtain advice from your local authority building standards department and from a qualified heating engineer.

### 3 Solar water heating

A solar water heating panel, usually fixed to the roof, uses the sun to pre-heat the hot water supply. This can significantly reduce the demand on the heating system to provide hot water and hence save fuel and money. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. You could be eligible for Renewable Heat Incentive payments which could appreciably increase the savings beyond those shown on your EPC, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

### 4 Solar photovoltaic (PV) panels

A solar PV system is one which converts light directly into electricity via panels placed on the roof with no waste and no emissions. This electricity is used throughout the home in the same way as the electricity purchased from an energy supplier. Planning permission might be required, building regulations generally apply to this work and a building warrant may be required, so it is best to check these with your local authority. The assessment does not include the effect of any Feed-in Tariff which could appreciably increase the savings that are shown on this EPC for solar photovoltaic panels, provided that both the product and the installer are certified by the Microgeneration Certification Scheme (or equivalent). Details of local MCS installers are available at [www.microgenerationcertification.org](http://www.microgenerationcertification.org).

## Low and zero carbon energy sources

Low and zero carbon (LZC) energy sources are sources of energy that release either very little or no carbon dioxide into the atmosphere when they are used. Installing these sources may help reduce energy bills as well as cutting carbon.

**LZC energy sources present:** There are none provided for this home

## Your home's heat demand

You could receive Renewable Heat Incentive (RHI) payments and help reduce carbon emissions by replacing your existing heating system with one that generates renewable heat and, where appropriate, having your loft insulated and cavity walls filled. The estimated energy required for space and water heating will form the basis of the payments. For more information go to [www.energysavingtrust.org.uk/scotland/rhi](http://www.energysavingtrust.org.uk/scotland/rhi).

Heat demand	Existing dwelling	Impact of loft insulation	Impact of cavity wall insulation	Impact of solid wall insulation
Space heating (kWh per year)	11,305	N/A	N/A	N/A
Water heating (kWh per year)	2,747			



## About this document

This Recommendations Report and the accompanying Energy Performance Certificate are valid for a maximum of ten years. These documents cease to be valid where superseded by a more recent assessment of the same building carried out by a member of an Approved Organisation.

The Energy Performance Certificate and this Recommendations Report for this building were produced following an energy assessment undertaken by an assessor accredited by Elmhurst ([www.elmhurstenergy.co.uk](http://www.elmhurstenergy.co.uk)), an Approved Organisation Appointed by Scottish Ministers. The certificate has been produced under the Energy Performance of Buildings (Scotland) Regulations 2008 from data lodged to the Scottish EPC register. You can verify the validity of this document by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and entering the report reference number (RRN) printed at the top of this page.

Assessor's name:	Mr. David Simpson
Assessor membership number:	EES/008381
Company name/trading name:	Hardies Property & Construction Consultants
Address:	10 Viewfield Place Stirling FK8 1NQ
Phone number:	01786 474476
Email address:	<a href="mailto:david.simpson@hardies.co.uk">david.simpson@hardies.co.uk</a>
Related party disclosure:	No related party

If you have any concerns regarding the content of this report or the service provided by your assessor you should in the first instance raise these matters with your assessor and with the Approved Organisation to which they belong. All Approved Organisations are required to publish their complaints and disciplinary procedures and details can be found online at the web address given above.

### Use of this energy performance information

This Certificate and Recommendations Report will be available to view online by any party with access to the report reference number (RRN) and to organisations delivering energy efficiency and carbon reduction initiatives on behalf of the Scottish and UK Governments. If you are the current owner or occupier of this building and do not wish this data to be used by these organisations to contact you in relation to such initiatives, please opt out by visiting [www.scottishepcregister.org.uk](http://www.scottishepcregister.org.uk) and your data will be restricted accordingly. Further information on this and on Energy Performance Certificates in general can be found at [www.scotland.gov.uk/epc](http://www.scotland.gov.uk/epc).

## **Opportunity to benefit from a Green Deal on this property**

Under a Green Deal, the cost of the improvements is repaid over time via a credit agreement. Repayments are made through a charge added to the electricity bill for the property.

To see which improvements are recommended for this property, please turn to page 3. You can choose which improvements you want to install and ask for a quote from an authorised Green Deal provider. They will organise installation by an authorised Green Deal installer. If you move home, the responsibility for paying the Green Deal charge under the credit agreement passes to the new electricity bill payer.

For householders in receipt of income-related benefits, additional help may be available.

To find out more, visit [www.greenerscotland.org](http://www.greenerscotland.org) or call 0808 808 2282.





## Single Survey



# Single Survey

survey report on:

<b>Property address</b>	89 Benview Bannockburn Stirling FK7 0HJ
<b>Customer</b>	Ms M Khalida
<b>Customer address</b>	89 Benview Bannockburn Stirling FK7 0HJ
<b>Prepared by</b>	Hardies Property & Construction Consultants
<b>Date of inspection</b>	6th October 2015



## PART 1 - GENERAL

### 1.1 THE SURVEYORS

The Seller has engaged the Surveyors to provide the Single Survey Report and a generic Mortgage Valuation Report for Lending Purposes. The Seller has also engaged the Surveyors to provide an Energy Report in the format prescribed by the accredited Energy Company.

The Surveyors are authorised to provide a transcript or retype of the generic Mortgage Valuation Report on to Lender specific pro-forma. Transcript reports are commonly requested by Brokers and Lenders. The transcript report will be in the format required by the Lender but will contain the same information, inspection date and valuation figure as the generic Mortgage Valuation Report and the Single Survey. The Surveyors will decline any transcript request which requires the provision of information additional to the information in the Report and the generic Mortgage Valuation Report until the Seller has conditionally accepted an offer to purchase made in writing.

Once the Seller has conditionally accepted an offer to purchase made in writing, the Purchaser's lender or conveyancer may request that the Surveyors provide general comment on standard appropriate supplementary documentation. In the event of a significant amount of documentation being provided to the Surveyors, an additional fee may be incurred by the Purchaser. Any additional fee will be agreed in writing.

If information is provided to the Surveyors during the conveyancing process which materially affects the valuation stated in the Report and generic Mortgage Valuation Report, the Surveyors reserve the right to reconsider the valuation. Where the Surveyors require to amend the valuation in consequence of such information, they will issue an amended Report and generic Mortgage Valuation Report to the Seller. It is the responsibility of the Seller to ensure that the amended Report and generic Mortgage Valuation Report are transmitted to every prospective Purchaser.

The individual Surveyor will be a member of the Royal Institution of Chartered Surveyors who is competent to survey, value and report upon Residential Property<sup>1</sup>.

If the Surveyors have had a previous business relationship within the past two years with the Seller or Sellers Agent or relative to the property, they will be obliged to indicate this by ticking the adjacent box.

The Surveyors have a written complaints handling procedure. This is available from the offices of the Surveyors at the address stated.

### 1.2 THE REPORT

The Surveyors will not provide an amended Report on the Property, except to correct factual inaccuracies.

The Report will identify the nature and source of information relied upon in its preparation.

The Surveyor shall provide a Market Value of the Property, unless the condition of the Property is such that it would be inappropriate to do so. A final decision on whether a loan will be granted rests with the Lender who may impose retentions in line with their lending criteria. The date of condition and value of the property will be the date of inspection.

To date, Purchasers have normally obtained their own report from their chosen Surveyor. By contrast, a Single Survey is instructed by the Seller and made available to all potential Purchasers in the expectation that the successful Purchaser will have relied upon it. The Royal Institution of Chartered Surveyors rules require disclosure of any potential conflict of interest when acting for the Seller and the Purchaser in the same transaction. The Single Survey may give rise to a conflict of interest and if this is of concern to any party they are advised to seek their own independent advice.

---

<sup>1</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct.

# Terms and Conditions

The Report and any expressions or assessments in it are not intended as advice to the Seller or Purchaser or any other person in relation to an asking price or any other sales or marketing decisions. The Report is based solely on the Property and is not to be relied upon in any manner whatsoever when considering the valuation or condition of any other property.

If certain minor matters are mentioned in the Report it should not be assumed that the Property is free of other minor defects.

Neither the whole nor any part of the Report may be published in any way, reproduced or distributed by any party other than the Seller, prospective purchasers and the Purchaser and their respective professional advisers without the prior written consent of the Surveyors.

## 1.3 LIABILITY

The Report is prepared with the skill and care reasonably to be expected of a competent residential surveyor who is a member of the Royal Institution of Chartered Surveyors.

The Report is addressed to the Seller and was prepared in the expectation that it (or a complete copy) along with these Terms and Conditions (or a complete copy) would (or, as the case might be, would have been) be disclosed and delivered to:-

- the Seller;
- any person(s) noting an interest in purchasing the Property from the Seller;
- any person(s) who make(s) (or on whose behalf is made) an offer to purchase the Property, whether or not that offer is accepted by the Seller;
- the Purchaser; and
- the professional advisers of any of these.

The Surveyors acknowledge that their duty of skill and care in relation to the Report is owed to the Seller and to the Purchaser. The Surveyors accept no responsibility or liability whatsoever in relation to the Report to persons other than the Seller and the Purchaser. The Seller and Purchaser should be aware that if a Lender seeks to rely on this Report they do so at their own risk. In particular, the Surveyors accept no responsibility or liability whatsoever to any Lender in relation to the Report. Any such Lender relies upon the Report entirely at their own risk.

## 1.4 GENERIC MORTGAGE VALUATION REPORT

The Surveyors undertake to the Seller that they will prepare a generic Mortgage Valuation Report, which will be issued along with the Single Survey. It is the responsibility of the Seller to ensure that the generic Mortgage Valuation Report is provided to every potential Purchaser.

## 1.5 TRANSCRIPT MORTGAGE VALUATION FOR LENDING PURPOSES

The Surveyors undertake that on being asked to do so by a prospective purchaser, or his/her professional advisor or Lender, they will prepare a Transcript Mortgage Valuation Report for Lending Purposes on terms and conditions to be agreed between the Surveyors and Lender and solely for the use of the Lender and upon which the Lender may rely. The decision as to whether finance will be provided is entirely a matter for the Lender. The Transcript Mortgage Valuation Report<sup>2</sup> will be from information contained in the Report and the generic Mortgage Valuation Report.

---

<sup>2</sup> Which shall be in accordance with the current RICS Valuation Standards (The Red Book) and RICS Rules of Conduct

## 1.6 INTELLECTUAL PROPERTY

All intellectual property rights whatsoever (including copyright) in and to the Report, excluding the headings and rubrics, are the exclusive property of the Surveyors and shall remain their exclusive property unless they assign the same to any other party in writing.

## 1.7 PAYMENT

The Surveyors are entitled to refrain from delivering the Report to anyone until the fee and other charges for it notified to the Seller have been paid. Additional fees will be charged for subsequent inspections and Reports.

## 1.8 CANCELLATION

The Seller will be entitled to cancel the inspection by notifying the Surveyor's office at any time before the day of the inspection.

The Surveyor will be entitled not to proceed with the inspection (and will so report promptly to the Seller) if after arriving at the property, the Surveyor concludes that it is of a type of construction of which the surveyor has insufficient specialist knowledge to be able to provide the inspection satisfactorily. The Surveyor will also be entitled not to proceed if after arriving at the property, the surveyor concludes that the property is exempt under Part 3 of The Housing (Scotland) Act 2006 as detailed in the (Prescribed Documents) Regulations 2008. If there is a potential threat to their health or personal safety, the inspection may be postponed or cancelled, at the Surveyor's discretion.

In the case of cancellation or the inspection not proceeding, the Surveyor will refund any fees paid by the Seller for the inspection and Report, except for expenses reasonably incurred and any fee due in light of the final paragraph of this section.

In the case of cancellation by the Seller, for whatever reason, after the inspection has taken place but before a written report is issued, the Surveyor will be entitled to raise an Invoice equivalent to 80% of the agreed fee.

## 1.9 PRECEDENCE

If there is any incompatibility between these Terms and Conditions and the Report, these Terms and Conditions take precedence.

## 1.10 DEFINITIONS

- the "Lender" is the party who has provided or intends or proposes to provide financial assistance to the Purchaser towards the purchase of the Property and in whose favour a standard security will be granted over the Property;
- the "Transcript Mortgage Valuation Report for Lending Purposes" means a separate report, prepared by the Surveyor, prepared from information in the Report and the generic Mortgage Valuation Report, but in a style and format required by the Lender. The Transcript Mortgage Valuation Report for Lending Purposes will be prepared with the skill and care reasonably to be expected from a surveyor who is a member of the Royal Institution of Chartered Surveyors and who is competent to survey, value and report on the Property;
- the "Generic Mortgage Valuation Report" means a separate report, prepared by the Surveyor from information in the Report but in the Surveyor's own format;



- the "Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion;
- the "Property" is the property which forms the subject of the Report;
- the "Purchaser" is the person (or persons) who enters into a contract to buy the Property from the Seller;
- a "prospective Purchaser" is anyone considering buying the Property;
- the "Report" is the report, of the kind described in Part 2 of these Terms and Conditions and in the form set out in part 1 of Schedule 1 of the Housing (Scotland) Act 2006 (Prescribed Documents) Regulations 2008;
- the "Seller" is/are the proprietor(s) of the Property;
- the "Surveyor" is the author of the Report on the Property; and
- the "Surveyors" are the firm or company of which the Surveyor is an employee, director, member or partner (unless the Surveyor is not an employee, director, member or partner, when the "Surveyors" means the Surveyor) whose details are set out at the head of the Report.
- the "Energy Report" is the advice given by the accredited Energy Company, based on information collected by the Surveyor during the Inspection, and also includes an Energy Performance Certificate, in a Government approved format.

## PART 2 - DESCRIPTION OF THE REPORT

### 2.1 THE SERVICE

The Single Survey is a Report by an independent Surveyor, prepared in an objective way regarding the condition and value of the Property on the day of the inspection, and who is a member of the Royal Institution of Chartered Surveyors. It includes an Energy Report as required by Statute and this is in the format of the accredited Energy Company. In addition, the Surveyor has agreed to supply a generic Mortgage Valuation Report.

### 2.2 THE INSPECTION

The Inspection is a general surface examination of those parts of the Property which are accessible: in other words, visible and readily available for examination from ground and floor levels, without risk of causing damage to the Property or injury to the Surveyor.

All references to visual inspection refer to an inspection from within the property at floor level and from ground level within the site and adjoining public areas, without the need to move any obstructions. Any references to left or right are taken facing the front of the property.

The Inspection is carried out with the Seller's permission, without causing damage to the building or contents. Furniture, stored items and insulation are not moved.

Unless identified in the report the Surveyor will assume that no harmful or hazardous materials have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

The Surveyor will not carry out an asbestos inspection, and will not be acting as an asbestos inspector in completing a Single Survey of properties that may fall within the Control of Asbestos in the Workplace Regulations. In the case of flats it will be assumed that there is a duty holder, as defined in the Regulations and that a Register of Asbestos and effective Management Plan is in place, which does not require any expenditure, or pose a significant risk to health. No enquiry of the duty holder will be made.

## 2.3 THE REPORT

The Report will be prepared by the Surveyor who carried out the property inspection and will describe various aspects of the property as defined by the headings of the Single Survey report with the comments being general and unbiased. The report on the location, style and condition of the property, will be concise and will be restricted to matters that could have a material effect upon value and will omit items that, in the Surveyor's opinion, are not significant. If certain minor matters are mentioned, it should not be interpreted that the property is free of any other minor defects.

Throughout the report, the following repair categories will be used to give an overall opinion of the state of repair and condition of the property.

1. Category 3: Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.
2. Category 2: Repairs or replacement requiring future attention, but estimates are still advised.
3. Category 1: No immediate action or repair is needed.

### **WARNING:**

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions when the effect can be considerable.

Parts of the property, which cannot be seen or accessed, will not be reported upon and this will be stated. If the Surveyor suspects that a defect may exist within an unexposed area and which could have a material effect upon the value, he may recommend further investigation by specialist contractors.

## 2.4 SERVICES

Surveyors are not equipped or qualified to test the services and therefore no comment can be interpreted as implying that the design, installation and function of the services are in accordance/compliance with regulations, safety and efficiency expectations. However, comment is made where there is cause to suspect significant defects or shortcomings with the installations. No tests are made of any services or appliances.

## 2.5 ACCESSIBILITY

A section is included to help identify the basic information interested parties need to know to decide whether to view a property.

## 2.6 ENERGY REPORT

A section is included that makes provision for an Energy Report, relative to the property. The Surveyor will collect physical data from the property and provide such data in a format required by an accredited Energy Company. The Surveyor cannot of course accept liability for any advice given by the Energy Company.

## 2.7 VALUATION AND CONVEYANCER ISSUES

The last section of the Report contains matters considered relevant to the Conveyancer (Solicitor). It also contains the Surveyor's opinion both of the market value of the property and of the re-instatement cost, as defined below.

"Market Value" is the estimated amount for which a property should exchange on the date of valuation between a willing buyer and a willing seller in an arm's-length transaction after proper marketing wherein the parties had each acted knowledgeably, prudently and without compulsion. In arriving at the opinion of the Market Value, the Surveyor also makes various standard assumptions covering, for example, vacant possession; tenure and other legal considerations; contamination and hazardous materials; the condition of un-inspected parts; the right to use mains services; and the exclusion of curtains, carpets etc. from the valuation. In the case of flats, the following further assumptions are made that:

- There are rights of access and exit over all communal roadways, corridors, stairways etc. and to use communal grounds, parking areas, and other facilities;
- There are no particularly troublesome or unusual legal restrictions;
- There is no current dispute between the occupiers of the flats or any outstanding claims or losses; and the costs of repairs to the building are shared among the co-proprietors on an equitable basis.

Any additional assumption, or any found not to apply, is reported.

"Re-instatement cost" is an estimate for insurance purposes of the current cost of rebuilding the Property in its present form unless otherwise stated. This includes the cost of rebuilding the garage and permanent outbuildings, site clearance and professional fees, but excludes VAT (except on the fees).

Sellers or prospective Purchasers may consider it prudent to instruct a reinspection and revaluation after a period of 12 weeks (or sooner if appropriate) to reflect changing circumstances in the market and/or in the physical condition of the Property.

## 1. Information and scope of inspection

This section tells you about the type, accommodation, neighbourhood, age and construction of the property. It also tells you about the extent of the inspection and highlights anything that the surveyor could not inspect.

All references to visual inspection refer to an inspection from within the property without moving any obstructions and externally from ground level within the site and adjoining public areas. Any references to left or right in a description of the exterior of the property refer to the view of someone standing facing that part of the property from the outside.

The inspection is carried out without causing damage to the building or its contents and without endangering the occupiers or the surveyor. Heavy furniture, stored items and insulation are not moved. Unless identified in the report the surveyor will assume that no harmful or hazardous materials or techniques have been used in the construction. The presence or possible consequences of any site contamination will not be researched.

Services such as TV/cable connection, internet connection, swimming pools and other leisure facilities etc. will not be inspected or reported on.

<b>Description</b>	Detached house, two storeys in height with single storey extension to rear and single integral garage.
<b>Accommodation</b>	Ground Floor: Entrance, Hallway, Living Room, Kitchen/ Dining Area, Dining Room/ Study, WC/ Cloakroom, Sun Room Extension First Floor: 4 Bedrooms (Master with En-Suite Shower Room), Family Bathroom
<b>Gross internal floor area (m<sup>2</sup>)</b>	142.5
<b>Neighbourhood and location</b>	The subjects are situated in a privately built residential estate. Surrounding properties mainly comprise similar detached houses. The property is located within reasonable proximity of all local amenities available within the city of Stirling.
<b>Age</b>	Built circa 2005.
<b>Weather</b>	At the time of our inspection, weather conditions were overcast but dry after heavy rain.
<b>Chimney stacks</b>	None.
<b>Roofing including roof space</b>	<b>Sloping roofs were visually inspected with the aid of binoculars where appropriate.</b> <b>Flat roofs were visually inspected from vantage points within the property and where safe and reasonable to do so from a 3m ladder externally.</b> <b>Roof spaces were visually inspected and were entered where there was safe and reasonable access, normally defined as being from a 3m ladder within the property.</b> <b>If this is not possible, then physical access to the roof space may be taken by other means if the Surveyor deems it safe and</b>

# Single Survey

	<p><b>reasonable to do so.</b></p> <p>The roof is of timber pitched trusses, weathered externally with interlocking concrete tiles.</p> <p>The roof space is accessible via a hatch from the upper landing and is partially floored and fitted with approximately 200mm of insulation material.</p>
<b>Rainwater fittings</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p>Rainwater fittings including gutters and downpipes are of PVC.</p>
<b>Main walls</b>	<p><b>Visually inspected with the aid of binoculars where appropriate.</b></p> <p><b>Foundations and concealed parts were not exposed or inspected.</b></p> <p>Main exterior walls are of cavity brickwork with blockwork roughcast rendered external finish.</p>
<b>Windows, external doors and joinery</b>	<p><b>Internal and external doors were opened and closed where keys were available.</b></p> <p><b>Random windows were opened and closed where possible.</b></p> <p><b>Doors and windows were not forced open.</b></p> <p>Windows are of UPVC frames with double glazing.</p> <p>Front door is of metal frame work with a wood effect finish and a 5 point locking system.</p> <p>Patio doors to the rear are of PVC construction with double glazing.</p> <p>Eaves details are of PVC.</p>
<b>External decorations</b>	<p><b>Visually inspected.</b></p> <p>Minimal exterior decoration.</p>
<b>Conservatories / porches</b>	<p>None.</p>
<b>Communal areas</b>	<p>None.</p>

# Single Survey

<b>Garages and permanent outbuildings</b>	<b>Visually inspected.</b>  Single integral garage with access door from the kitchen/ dining area. The garage has a metal up- and-over vehicular door to the front, concrete floor and plasterboard walls and ceilings.
<b>Outside areas and boundaries</b>	<b>Visually inspected.</b>  The subjects include garden grounds to the front and rear. The front garden incorporates driveway/ parking area. The rear garden is mainly hard landscaped and incorporates raised planting areas and patio.
<b>Ceilings</b>	<b>Visually inspected from floor level.</b>  Internally ceilings are of plasterboard with plastered finish.
<b>Internal walls</b>	<b>Visually inspected from floor level.</b>  <b>Using a moisture meter, walls were randomly tested for dampness where considered appropriate.</b>  Internal walls are of timber frame with plasterboard and plastered finish.
<b>Floors including sub floors</b>	<b>Surfaces of exposed floors were visually inspected. No carpets or floor coverings were lifted.</b>  <b>Sub-floor areas were inspected only to the extent visible from a readily accessible and unfixed hatch by way of an inverted "head and shoulders" inspection at the access point.</b>  <b>Physical access to the sub floor area may be taken if the Surveyor deems it is safe and reasonable to do so, and subject to a minimum clearance of 1m between the underside of floor joists and the solum as determined from the access hatch.</b>  Floors are of suspended timber formation throughout with tongued and grooved boarding.
<b>Internal joinery and kitchen fittings</b>	<b>Built-in cupboards were looked into but no stored items were moved.</b>  <b>Kitchen units were visually inspected excluding appliances.</b>  Internal joinery is standard for a building of this age and incorporates MDF skirtings, facings etc.  Kitchen fittings incorporate base and wall storage units, worktop space and sink unit.

# Single Survey

<b>Chimney breasts and fireplaces</b>	<b>Visually inspected.</b> <b>No testing of the flues or fittings was carried out.</b> Gas living flame fire within the living room area with balanced flue to external gable wall.
<b>Internal decorations</b>	<b>Visually inspected.</b> Painted finishes throughout.
<b>Cellars</b>	None.
<b>Electricity</b>	<b>Accessible parts of the wiring were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b> Mains electrical supply. The electricity meter and distribution unit are located within a cupboard under the stairs.
<b>Gas</b>	<b>Accessible parts of the system were visually inspected without removing fittings. No tests whatsoever were carried out to the system or appliances. Visual inspection does not assess any services to make sure they work properly and efficiently and meet modern standards. If any services are turned off, the surveyor will state that in the report and will not turn them on.</b> Mains gas supply. Gas meter is located externally to the gable of the building.
<b>Water, plumbing, bathroom fittings</b>	<b>Visual inspection of the accessible pipework, water tanks, cylinders and fittings without removing any insulation.</b> <b>No tests whatsoever were carried out to the system or appliances.</b> Mains water supply. Plumbing throughout appears to be of copper or PVC. Sanitary fittings incorporate WC, wash-hand basin, bath and separate shower cubicle within bathroom. Large shower cubicle, WC and wash-hand basin with en-suite shower room and WC and wash-hand basin within cloakroom at ground floor level.

# Single Survey

<b>Heating and hot water</b>	<p><b>Accessible parts of the system were visually inspected apart from communal systems, which were not inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Heating is provided via a gas fired regular boiler located within the garage providing hot water to radiators throughout the property.</p> <p>Hot water is also provided via the boiler and stored within a hot water storage cylinder located at first floor level.</p>
<b>Drainage</b>	<p><b>Drainage covers etc. were not lifted.</b></p> <p><b>Neither drains nor drainage systems were tested.</b></p> <p>Drainage is connected to the public sewer.</p>
<b>Fire, smoke and burglar alarms</b>	<p><b>Visually inspected.</b></p> <p><b>No tests whatsoever were carried out to the system or appliances.</b></p> <p>Smoke and burglar alarms fitted.</p>
<b>Any additional limits to inspection</b>	<p><b>For flats / maisonettes</b></p> <p><b>Only the subject flat and internal communal areas giving access to the flat were inspected.</b></p> <p><b>If the roof space or under-building / basement is communal, reasonable and safe access is not always possible. If no inspection was possible, this will be stated. If no inspection was possible, the surveyor will assume that there are no defects that will have a material effect on the valuation.</b></p> <p><b>The building containing the flat, including any external communal areas, was visually inspected only to the extent that the surveyor is able to give an opinion on the general condition and standard of maintenance.</b></p> <p>No access to sub-floor areas was available at the time of our inspection.</p> <p>Limited access to the roof space area was available due to the presence of insulation material and stored items.</p> <p>External inspection was carried out from ground level only.</p> <p>We have not carried out an inspection for Japanese Knotweed or other invasive plant species and unless otherwise stated for the purposes of this report we have assumed that there is no Japanese Knotweed or other invasive plant species within the boundaries of the property or in neighbouring properties. The identification of Japanese Knotweed or other invasive plant species should be made by a Specialist Contractor.</p>



## Sectional Diagram showing elements of a typical house




Reference may be made in this report to some or all of the above component parts of the property. This diagram may assist you in locating and understanding these items.


# Single Survey

## 2. Condition


This section identifies problems and tells you about the urgency of any repairs by using one of the following three categories:


Category 3	Category 2	Category 1
Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.	Repairs or replacement requiring future attention, but estimates are still advised.	No immediate action or repair is needed.

 Structural movement	
Repair category	1
Notes	No evidence of any current settlement or structural movement was noted upon inspection of the property.

 Dampness, rot and infestation	
Repair category	1
Notes	No evidence of any rising or ingressive dampness, timber rot or infestation was noted upon inspection of the property.

 Chimney stacks	
Repair category	-
Notes	Not applicable.

 Roofing including roof space	
Repair category	1
Notes	The roof covering appears to be free from obvious defect and no major defects were noted upon inspection.  No obvious defects were noted upon limited inspection of the roof space area.

 Rainwater fittings	
Repair category	1
Notes	Rainwater fittings all appear to be serviceable and no major defects were noted upon inspection.

# Single Survey



## Main walls

<b>Repair category</b>	1
<b>Notes</b>	No obvious defects were noted upon inspection of external walls.



## Windows, external doors and joinery

<b>Repair category</b>	1
<b>Notes</b>	No significant defects were noted upon inspection of these elements of the building.



## External decorations

<b>Repair category</b>	1
<b>Notes</b>	Exterior decoration was found to be satisfactory.



## Conservatories/porches

<b>Repair category</b>	-
<b>Notes</b>	Not applicable.



## Communal areas

<b>Repair category</b>	-
<b>Notes</b>	Not applicable.



## Garages and permanent outbuildings

<b>Repair category</b>	1
<b>Notes</b>	No significant defects noted upon inspection of integral garage.



## Outside areas and boundaries

<b>Repair category</b>	1
<b>Notes</b>	Garden grounds appeared to be relatively well laid out, maintained and enclosed.

# Single Survey



## Ceilings

<b>Repair category</b>	1
<b>Notes</b>	No significant defects noted upon inspection of these elements of the building.



## Internal walls

<b>Repair category</b>	1
<b>Notes</b>	No specific defects noted upon inspection of these elements of the building.



## Floors including sub-floors

<b>Repair category</b>	1
<b>Notes</b>	No significant defects noted upon inspection of visible areas.



## Internal joinery and kitchen fittings

<b>Repair category</b>	1
<b>Notes</b>	Internal joinery and kitchen fittings appeared to be generally in an order consistent with a property of this age and type.  There is evidence of minor age and wear to internal joinery and kitchen fittings.



## Chimney breasts and fireplaces

<b>Repair category</b>	1
<b>Notes</b>	No significant defects noted upon inspection of fireplace within the living room area.  No testing was undertaken.



## Internal decorations

<b>Repair category</b>	1
<b>Notes</b>	Interior decorations was found to be in reasonable order throughout.



## Cellars

<b>Repair category</b>	-
<b>Notes</b>	Not applicable.

# Single Survey



## Electricity

<b>Repair category</b>	1
<b>Notes</b>	The visual inspection has indicated there are no obvious signs of any significant defects or deficiencies that might suggest there could be major issues with the system.



## Gas

<b>Repair category</b>	1
<b>Notes</b>	No obvious defects or deficiencies were noted upon inspection.



## Water, plumbing and bathroom fittings

<b>Repair category</b>	1
<b>Notes</b>	Plumbing system is to a modern pattern and appears to be adequate and no obvious defects were noted upon inspection of sanitary fittings.



## Heating and hot water

<b>Repair category</b>	1
<b>Notes</b>	The visual inspection has indicated that there are no obvious signs of any significant defects or deficiencies that might suggest there could be major issues with the system.



## Drainage

<b>Repair category</b>	1
<b>Notes</b>	No obvious defects were noted upon inspection of visible drainage connections.

# Single Survey

Set out below is a summary of the condition of the property which is provided for reference only. You should refer to the previous comments for detailed information.

Structural movement	1
Dampness, rot and infestation	1
Chimney stacks	-
Roofing including roof space	1
Rainwater fittings	1
Main walls	1
Windows, external doors and joinery	1
External decorations	1
Conservatories/porches	-
Communal areas	-
Garages and permanent outbuildings	1
Outside areas and boundaries	1
Ceilings	1
Internal walls	1
Floors including sub-floors	1
Internal joinery and kitchen fittings	1
Chimney breasts and fireplaces	1
Internal decorations	1
Cellars	-
Electricity	1
Gas	1
Water, plumbing and bathroom fittings	1
Heating and hot water	1
Drainage	1

## Category 3

Urgent repairs or replacement are needed now. Failure to deal with them may cause problems to other parts of the property or cause a safety hazard. Estimates for repairs or replacement are needed now.

## Category 2

Repairs or replacement requiring future attention, but estimates are still advised.

## Category 1

No immediate action or repair is needed.

### Remember

The cost of repairs may influence the amount someone is prepared to pay for the property. We recommend that relevant estimates and reports are obtained in your own name.

### Warning

If left unattended, even for a relatively short period, Category 2 repairs can rapidly develop into more serious Category 3 repairs. The existence of Category 2 or Category 3 repairs may have an adverse effect on marketability, value and the sale price ultimately achieved for the property. This is particularly true during slow market conditions where the effect can be considerable.

# Single Survey

## 3. Accessibility information

### Guidance notes on accessibility information

*Three steps or fewer to a main entrance door of the property:*

In flatted developments the 'main entrance' would be the flat's own entrance door, not the external door to the communal stair. The 'three steps or fewer' are counted from external ground level to the flat's entrance door. Where a lift is present, the count is based on the number of steps climbed when using the lift.

*Unrestricted parking within 25 metres:*

For this purpose, 'Unrestricted parking' includes parking available by means of a parking permit. Restricted parking includes parking that is subject to parking restrictions, as indicated by the presence of solid yellow, red or white lines at the edge of the road or by a parking control sign, parking meters or other coin-operated machines.

1. Which floor(s) is the living accommodation on?	Ground
2. Are there three steps or fewer to a main entrance door of the property?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
3. Is there a lift to the main entrance door of the property?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
4. Are all door openings greater than 750mm?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
5. Is there a toilet on the same level as the living room and kitchen?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
6. Is there a toilet on the same level as a bedroom?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>
7. Are all rooms on the same level with no internal steps or stairs?	Yes <input type="checkbox"/> No <input checked="" type="checkbox"/>
8. Is there unrestricted parking within 25 metres of an entrance door to the building?	Yes <input checked="" type="checkbox"/> No <input type="checkbox"/>

## 4. Valuation and conveyancer issues

This section highlights information that should be checked with a solicitor or licensed conveyancer. It also gives an opinion of market value and an estimated reinstatement cost for insurance purposes.

### Matters for a solicitor or licensed conveyancer

Confirmation of Local Authority consents and approvals for rear sun room extension and minor internal alterations carried out in/ around 2010.

The subjects carry the remainder of a 10 year NHBC Warranty to September 2015.

The subjects are currently let on a Short Assured Tenancy at a rental of £895 pcm. It is understood that the tenancy terminates in November 2015 and will be sold with vacant possession after the tenant has vacated.

### Estimated reinstatement cost for insurance purposes

The reinstatement figure for insurance purposes can be stated at £260,000 (Two Hundred and Sixty Thousand Pounds).

### Valuation and market comments

My valuation of the property as at reflecting current market conditions can be reasonably stated at £215,000 (Two Hundred and Fifteen Thousand Pounds).

<b>Signed</b>	Security Print Code [503783 = 4022 ] Electronically signed
<b>Report author</b>	David Simpson
<b>Company name</b>	Hardies Property & Construction Consultants
<b>Address</b>	10 Viewfield Place, Stirling, FK8 1NQ
<b>Date of report</b>	7th October 2015



# Mortgage Valuation Report



## Property Address

Address 89 Benview, Bannockburn, Stirling, FK7 0HJ  
Seller's Name Ms M Khalida  
Date of Inspection 6th October 2015

## Property Details

Property Type  House  Bungalow  Purpose built maisonette  Converted maisonette  
 Purpose built flat  Converted flat  Tenement flat  Flat over non-residential use  
 Other (specify in General Remarks)

Property Style  Detached  Semi detached  Mid terrace  End terrace  
 Back to back  High rise block  Low rise block  Other (specify in General Remarks)

Does the surveyor believe that the property was built for the public sector, e.g. local authority, military, police?  Yes  No

Flats/Maisonettes only Floor(s) on which located  No. of floors in block  Lift provided?  Yes  No  
No. of units in block

Approximate Year of Construction

## Tenure

Absolute Ownership  Leasehold Ground rent £  Unexpired years

## Accommodation

Number of Rooms  Living room(s)  Bedroom(s)  Kitchen(s)  
 Bathroom(s)  WC(s)  Other (Specify in General remarks)

Gross Floor Area (excluding garages and outbuildings)  m<sup>2</sup> (Internal)  m<sup>2</sup> (External)

Residential Element (greater than 40%)  Yes  No

## Garage / Parking / Outbuildings

Single garage  Double garage  Parking space  No garage / garage space / parking space  
Available on site?  Yes  No

Permanent outbuildings:

Single integral garage.

# Mortgage Valuation Report

## Construction

Walls  Brick  Stone  Concrete  Timber frame  Other (specify in General Remarks)  
Roof  Tile  Slate  Asphalt  Felt  Other (specify in General Remarks)

## Special Risks

Has the property suffered structural movement?  Yes  No

If Yes, is this recent or progressive?  Yes  No

Is there evidence, history, or reason to anticipate subsidence, heave, landslip or flood in the immediate vicinity?  Yes  No

If Yes to any of the above, provide details in General Remarks.

## Service Connections

Based on visual inspection only. If any services appear to be non-mains, please comment on the type and location of the supply in General Remarks.

Drainage  Mains  Private  None Water  Mains  Private  None  
Electricity  Mains  Private  None Gas  Mains  Private  None  
Central Heating  Yes  Partial  None

Brief description of Central Heating:

Full gas central heating from regular boiler.

## Site

Apparent legal issues to be verified by the conveyancer. Please provide a brief description in General Remarks.

Rights of way  Shared drives / access  Garage or other amenities on separate site  Shared service connections  
 Ill-defined boundaries  Agricultural land included with property  Other (specify in General Remarks)

## Location

Residential suburb  Residential within town / city  Mixed residential / commercial  Mainly commercial  
 Commuter village  Remote village  Isolated rural property  Other (specify in General Remarks)

## Planning Issues

Has the property been extended / converted / altered?  Yes  No

If Yes provide details in General Remarks.

## Roads

Made up road  Unmade road  Partly completed new road  Pedestrian access only  Adopted  Unadopted

# Mortgage Valuation Report

## General Remarks

Internally and externally the subjects appeared to be in a generally good condition commensurate with their age and type and no major defects were noted upon inspection.

The subjects were extended around 2010 and it is understood that all necessary Local Authority consents and approvals are available for these works.

The subjects are currently let on a Short Assured Tenancy at a rental of £895 pcm. It is understood that the tenancy terminates in November 2015 and will be sold with vacant possession after the tenant has vacated.

## Essential Repairs

None.

Estimated cost of essential repairs £  Retention recommended?  Yes  No Amount £

# Mortgage Valuation Report

## Comment on Mortgageability

The subject provides suitable security for normal mortgage purposes.

## Valuations

Market value in present condition £ 215,000  
Market value on completion of essential repairs £  
Insurance reinstatement value £ 260,000  
(to include the cost of total rebuilding, site clearance, professional fees, ancillary charges plus VAT)  
Is a reinspection necessary?  Yes  No

## Buy To Let Cases

What is the reasonable range of monthly rental income for the property assuming a letting on a 6 month Short Assured Tenancy basis? £  
Is the property in an area where there is a steady demand for rented accommodation of this type?  Yes  No

## Declaration

Signed Security Print Code [503783 = 4022 ]  
Electronically signed by:-  
Surveyor's name David Simpson  
Professional qualifications BSc MRICS  
Company name Hardies Property & Construction Consultants  
Address 10 Viewfield Place, Stirling, FK8 1NQ  
Telephone 01786 474 476  
Fax 01786 448 305  
Report date 7th October 2015



## Property Questionnaire



# Property Questionnaire

<b>Property address</b>	89, Benview Ashwood, Bannockburn, Stirling, Stirlingshire, FK7 0HJ
-------------------------	---

<b>Seller(s)</b>	Ms M Khalida
------------------	--------------

<b>Completion date of property questionnaire</b>	15/06/2015
--	------------

# Property Questionnaire

## Note for sellers

- Please complete this form carefully. It is important that your answers are correct.
- The information in your answers will help ensure that the sale of your house goes smoothly. Please answer each question with as much detailed information as you can.
- If anything changes after you fill in this questionnaire but before the date of entry for the sale of your house, tell your solicitor or estate agent immediately.

## Information to be given to prospective buyer(s)

<b>1.</b>	<b>Length of ownership</b>	
	<b>How long have you owned the property?</b>	9yrs 9months
<b>2.</b>	<b>Council tax</b>	
	<b>Which Council Tax band is your property in? (Please circle)</b>	
	A      B      C      D      E <b>F</b> G      H	
<b>3.</b>	<b>Parking</b>	
	<p><b>What are the arrangements for parking at your property?</b></p> <p><b>(Please tick all that apply)</b></p> <ul style="list-style-type: none"> <li>• Garage <input checked="" type="checkbox"/></li> <li>• Allocated parking space <input type="checkbox"/></li> <li>• Driveway <input checked="" type="checkbox"/></li> <li>• Shared parking <input type="checkbox"/></li> <li>• On street <input checked="" type="checkbox"/></li> <li>• Resident permit <input type="checkbox"/></li> <li>• Metered parking <input type="checkbox"/></li> <li>• Other (please specify): <input style="width: 450px; height: 20px;" type="text"/></li> </ul>	
<b>4.</b>	<b>Conservation area</b>	
	<p><b>Is your property in a designated Conservation Area (i.e. an area of special architectural or historical interest, the character or appearance of which it is desirable to preserve or enhance)?</b></p>	<p><b>Yes / No / <del>Don't know</del></b></p>



# Property Questionnaire

<b>5.</b>	<b>Listed buildings</b>	
	Is your property a Listed Building, or contained within one (i.e. a building recognised and approved as being of special architectural or historical interest)?	<b>Yes / No</b>
<b>6.</b>	<b>Alterations/additions/extensions</b>	
<b>a.</b>	<p><b>(i) During your time in the property, have you carried out any structural alterations, additions or extensions (for example, provision of an extra bath/shower room, toilet, or bedroom)?</b></p> <p><b><u>If you have answered yes</u>, please describe below the changes which you have made:</b></p> <p>Added a sunroom to the rear. Installed a internal door from the kitchen into garage. Put in a new window to the gable wall in the study.</p>	<b>Yes / No</b>
	<p><b>(ii) Did you obtain planning permission, building warrant, completion certificate and other consents for this work?</b></p> <p><b><u>If you have answered yes</u>, the relevant documents will be needed by the purchaser and you should give them to your solicitor as soon as possible for checking.</b></p> <p><b>If you do not have the documents yourself, please note below who has these documents and your solicitor or estate agent will arrange to obtain them:</b></p>	<b>Yes / No</b>
<b>b.</b>	<p><b>Have you had replacement windows, doors, patio doors or double glazing installed in your property?</b></p> <p><b><u>If you have answered yes</u>, please answer the three questions below:</b></p>	<b>Yes / No</b>
	<b>(i) Were the replacements the same shape and type as the ones you replaced?</b>	<b>Yes / No</b>
	<b>(ii) Did this work involve any changes to the window or door openings?</b>	<b>Yes / No</b>
	<p><b>(iii) Please describe the changes made to the windows, doors or patio doors (with approximate dates when the work was completed):</b></p> <p><b>Please give any guarantees which you received for this work to your solicitor or estate agent.</b></p>	

# Property Questionnaire

<b>7. Central heating</b>		
a.	<p>Is there a central heating system in your property? (Note: a partial central heating system is one which does not heat all the main rooms of the property - the main living room, the bedroom(s), the hall and the bathroom).</p> <p>If you have answered <u>yes / partial</u> - what kind of central heating is there? (Examples: gas-fired, solid fuel, electric storage heating, gas warm air).</p> <p>Gas</p> <p>If you have answered <u>yes</u>, please answer the three questions below:</p>	Yes / <del>No</del> / <del>Partial</del>
b.	When was your central heating system or partial central heating system installed?	Sep 2005
c.	<p>Do you have a maintenance contract for the central heating system?</p> <p>If you have answered <u>yes</u>, please give details of the company with which you have a maintenance contract:</p>	<del>Yes</del> / No
d.	When was your maintenance agreement last renewed? (Please provide the month and year).	
<b>8. Energy Performance Certificate</b>		
	Does your property have an Energy Performance Certificate which is less than 10 years old?	<del>Yes</del> / No
<b>9. Issues that may have affected your property</b>		
a.	<p>Has there been any storm, flood, fire or other structural damage to your property while you have owned it?</p> <p>If you have answered <u>yes</u>, is the damage the subject of any outstanding insurance claim?</p>	<p><del>Yes</del> / No</p> <p><del>Yes</del> / No</p>
b.	<p>Are you aware of the existence of asbestos in your property?</p> <p>If you have answered <u>yes</u>, please give details:</p>	<del>Yes</del> / No

# Property Questionnaire

<b>10.</b>	<b>Services</b>																									
<b>a.</b>	<p>Please tick which services are connected to your property and give details of the supplier:</p> <table border="1" style="width: 100%; border-collapse: collapse;"> <thead> <tr> <th style="text-align: center;">Services</th> <th style="text-align: center;">Connected</th> <th style="text-align: center;">Supplier</th> </tr> </thead> <tbody> <tr> <td>Gas / liquid petroleum gas</td> <td style="text-align: center;">✓</td> <td>Unknown</td> </tr> <tr> <td>Water mains / private water supply</td> <td style="text-align: center;">✓</td> <td>Unknown</td> </tr> <tr> <td>Electricity</td> <td style="text-align: center;">✓</td> <td>Unknown</td> </tr> <tr> <td>Mains drainage</td> <td style="text-align: center;">✓</td> <td>Unknown</td> </tr> <tr> <td>Telephone</td> <td style="text-align: center;">✓</td> <td>Unknown</td> </tr> <tr> <td>Cable TV / satellite</td> <td style="text-align: center;">✓</td> <td>Unknown</td> </tr> <tr> <td>Broadband</td> <td style="text-align: center;">✓</td> <td>Unknown</td> </tr> </tbody> </table>		Services	Connected	Supplier	Gas / liquid petroleum gas	✓	Unknown	Water mains / private water supply	✓	Unknown	Electricity	✓	Unknown	Mains drainage	✓	Unknown	Telephone	✓	Unknown	Cable TV / satellite	✓	Unknown	Broadband	✓	Unknown
Services	Connected	Supplier																								
Gas / liquid petroleum gas	✓	Unknown																								
Water mains / private water supply	✓	Unknown																								
Electricity	✓	Unknown																								
Mains drainage	✓	Unknown																								
Telephone	✓	Unknown																								
Cable TV / satellite	✓	Unknown																								
Broadband	✓	Unknown																								
<b>b.</b>	<p>Is there a septic tank system at your property?</p> <p><u>If you have answered yes</u>, please answer the two questions below:</p>	<b>Yes / No</b>																								
<b>c.</b>	(i) Do you have appropriate consents for the discharge from your septic tank?	<b>Yes / No / Don't know</b>																								
<b>d.</b>	(ii) Do you have a maintenance contract for your septic tank?	<b>Yes / No</b>																								
	<p><u>If you have answered yes</u>, please give details of the company with which you have a maintenance contract:</p>																									

# Property Questionnaire

<b>11.</b>	<b>Responsibilities for Shared or Common Areas</b>	
a.	<p>Are you aware of any responsibility to contribute to the cost of anything used jointly, such as the repair of a shared drive, private road, boundary, or garden area?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes / No / Don't Know</del>
b.	<p>Is there a responsibility to contribute to repair and maintenance of the roof, common stairwell or other common areas?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes / No / Not applicable</del>
c.	<p>Has there been any major repair or replacement of any part of the roof during the time you have owned the property?</p>	<del>Yes / No</del>
d.	<p>Do you have the right to walk over any of your neighbours' property - for example to put out your rubbish bin or to maintain your boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes / No</del>
e.	<p>As far as you are aware, do any of your neighbours have the right to walk over your property, for example to put out their rubbish bin or to maintain their boundaries?</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes / No</del>
f.	<p>As far as you are aware, is there a public right of way across any part of your property? (public right of way is a way over which the public has a right to pass, whether or not the land is privately-owned.)</p> <p><u>If you have answered yes, please give details:</u></p>	<del>Yes / No</del>
<b>12.</b>	<b>Charges associated with your property</b>	
a.	<p>Is there a factor or property manager for your property?</p> <p><u>If you have answered yes, please provide the name and address, and give details of any deposit held and approximate charges:</u></p>	<del>Yes / No</del>

# Property Questionnaire

b.	<p>Is there a common buildings insurance policy?</p> <p>If you have answered yes, is the cost of the insurance included in your monthly/annual factor's charges?</p>	<p><del>Yes / No / Don't Know</del></p> <p><del>Yes / No / Don't Know</del></p>
c.	<p>Please give details of any other charges you have to pay on a regular basis for the upkeep of common areas or repair works, for example to a residents' association, or maintenance or stair fund.</p>	
<p><b>13. Specialist works</b></p>		
a.	<p>As far as you are aware, has treatment of dry rot, wet rot, damp or any other specialist work ever been carried out to your property?</p> <p>If you have answered yes, please say what the repairs were for, whether you carried out the repairs (and when) or if they were done before you bought the property:</p>	<p><del>Yes / No</del></p>
b.	<p>As far as you are aware, has any preventative work for dry rot, wet rot, or damp ever been carried out to your property?</p> <p>If you have answered yes, please give details:</p>	<p><del>Yes / No</del></p>
c.	<p>If you have answered yes to 13(a) or (b), do you have any guarantees relating to this work?</p> <p>If you have answered yes, these guarantees will be needed by the purchaser and should be given to your solicitor as soon as possible for checking. If you do not have them yourself please write below who has these documents and your solicitor or estate agent will arrange for them to be obtained. You will also need to provide a description of the work carried out. This may be shown in the original estimate.</p> <p>Guarantees are held by:</p>	<p><del>Yes / No</del></p>

# Property Questionnaire

<b>14. Guarantees</b>							
<b>a. Are there any guarantees or warranties for any of the following:</b>							
(i)	Electrical work	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(ii)	Roofing	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iii)	Central heating	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(iv)	NHBC	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(v)	Damp course	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
(vi)	Any other work or installations? (for example, cavity wall insulation, underpinning, indemnity policy)	No	Yes	Don't know	With title deeds	Lost	Cannot Answer*
<b>b. If you have answered 'yes' or 'with title deeds', please give details of the work or installations to which the guarantee(s) relate(s):</b>							
NHBC Warranty							
<b>c. Are there any outstanding claims under any of the guarantees listed above?</b>						<b>Yes / No</b>	
<b>If you have answered yes, please give details:</b>							
<b>15. Boundaries</b>							
<b>So far as you are aware, has any boundary of your property been moved in the last 10 years?</b>						<b>Yes / No / Don't know</b>	
<b>If you have answered yes, please give details:</b>							

# Property Questionnaire

<b>16.</b>	<b>Notices that affect your property</b>	
	<b>In the past 3 years have you ever received a notice:</b>	
<b>a.</b>	<b>advising that the owner of a neighbouring property has made a planning application?</b>	<b>Yes / No / Don't know</b>
<b>b.</b>	<b>that affects your property in some other way?</b>	<b>Yes / No / Don't know</b>
<b>c.</b>	<b>that requires you to do any maintenance, repairs or improvements to your property?</b>	<b>Yes / No / Don't know</b>
	<b>If you have answered yes to any of a-c above, please give the notices to your solicitor or estate agent, including any notices which arrive at any time before the date of entry of the purchaser of your property.</b>	

**Declaration by the seller(s)/or other authorised body or person(s)**

**I/We confirm that the information in this form is true and correct to the best of my/our knowledge and belief.**

**Signature(s):** \_\_\_\_\_

\_\_\_\_\_

**Date:** \_\_\_\_\_

\_\_\_\_\_







**EDINBURGH**  
London House, Ground Floor  
20-22 East London Street  
Edinburgh EH7 4BQ  
Tel: 0131 557 9300 Fax: 0131 557 3520  
Email: edinburgh@hardies.co.uk

**ABERDEEN**  
The Coach House, 68 Spademill Lane  
Aberdeen AB15 4EZ  
Tel: 01224 325596 Fax: 01224 323403  
Email: aberdeen@hardies.co.uk

**DALKEITH**  
19 South Street, Dalkeith EH22 1AH  
Tel: 0131 663 2780 Fax: 0131 660 4594  
Email: dalkeith@hardies.co.uk

**DUNDEE**  
Whitehall House, 35 Yeaman Shore  
Dundee DD1 4BU  
Tel: 01382 220699  
Email: admin@christie-partners.co.uk

**DUNFERMLINE**  
The Signature Building, 8 Pitreavie Court  
Dunfermline KY11 8UU  
Tel: 01383 731841 Fax: 01383 739714  
Email: dunfermline@hardies.co.uk

**GALASHIELS**  
Anderson Chambers, Market Street  
Galashiels TD1 3AF  
Tel: 01896 668875 / 01896 755879  
Email: galashiels@hardies.co.uk

**GLASGOW**  
Suite 1.31, The Innovation Centre  
1 Ainslie Road, Hillington Park  
Glasgow G52 4RU  
Tel: 0141 585 6373 Fax: 0141 585 6372  
Email: glasgow@hardies.co.uk

**HAMILTON**  
29 Brandon Street, Hamilton ML3 6DA  
Tel: 01698 421214 Fax: 0141 585 6372  
Email: hamilton@hardies.co.uk

**HELENSBURGH**  
15-17 Colquhoun Street  
Helensburgh G84 8AN  
Tel: 01436 678181 Fax: 0141 585 6372  
Email: helensburgh@hardies.co.uk

**KILMARNOCK**  
35 Main Street, Stewarton  
Kilmarnock KA3 5BS  
Tel: 01560 480354 Fax: 0141 585 6372  
Email: kilmarnock@hardies.co.uk

**PAISLEY**  
Mirren Court 1, 119 Renfrew Road  
Paisley PA3 4EA  
Tel: 0141 887 4240 Fax: 0141 585 6372  
Email: paisley@hardies.co.uk

**PERTH**  
Old Academy Buildings  
7 Rose Terrace, Perth PH1 5HA  
Tel: 01738 631631 Fax: 01738 637768  
Email: perth@hardies.co.uk

**ST ANDREWS**  
Swilken House, 35 Largo Road  
St Andrews KY16 8NJ  
Tel: 01334 476469 Fax: 01334 477779  
Email: standrews@hardies.co.uk

**STIRLING**  
10 Viewfield Place, Stirling FK8 1NQ  
Tel: 01786 474476 Fax: 01786 448305  
Email: stirling@hardies.co.uk

In association with  
WJR Christie & Partners LLP  
Whitehall House  
35 Yeaman Shore  
DUNDEE DD1 4BU

[www.hardies.co.uk](http://www.hardies.co.uk)